


TO:	ALL PILOTS	DATE:	2 December 2024
TLN NUMBER:	041 - 2024		
SUBJECT:	<b>Judy Platform with Noble Intrepid and Ensco 120 alongside</b>		

**1. Comments**

The Judy platform will have the Noble Intrepid alongside until further notice. The Ensco 120 will be alongside the Judy Riser Platform.

**The Deep Arctic along with various vessels will be tasked within the Judy Platform area at various times between now and mid-October. When in the 500m zone, the applicable Radio Operator will add the position details to the weather report.**

**2. Photo/Dwg**

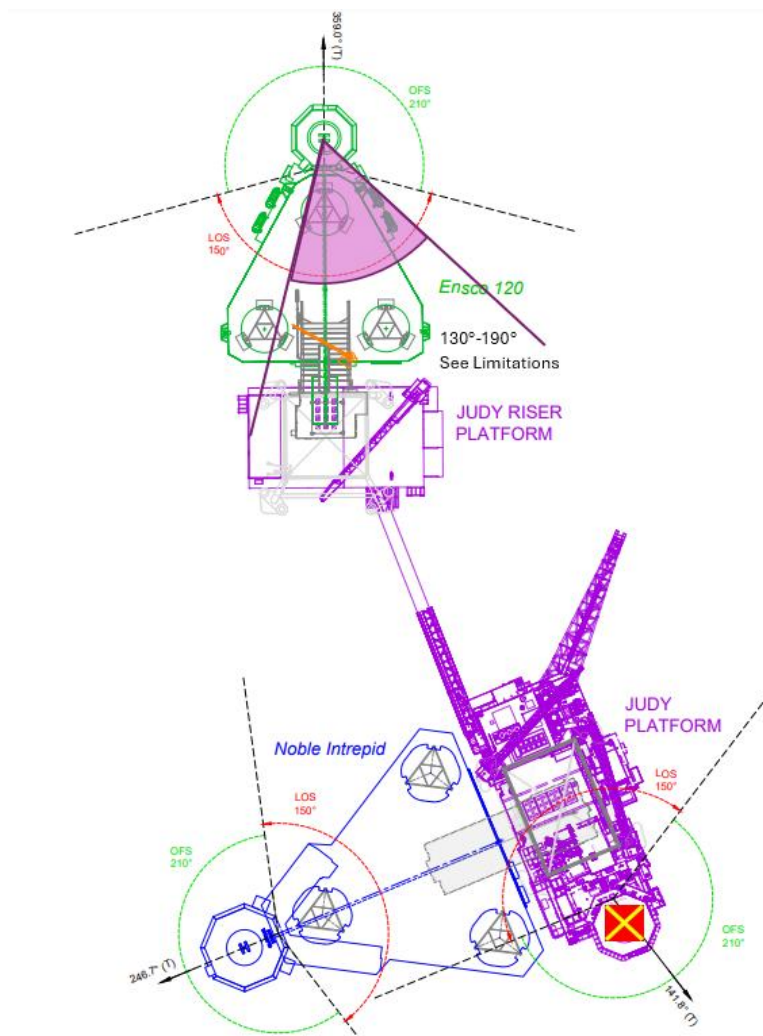

### 3. Existing HLL limitations

#### **Judy Platform**

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
141° to 161°	All	Platform <ul style="list-style-type: none"> <li>• Table 1 (T &amp; L) if overflight of the south / east and west monitor platforms is unavoidable</li> <li>• Prohibited Landing Heading Sector &amp; Offset TD/PM - HLO Refuge</li> <li>• Cleared for S92</li> </ul>	<b>210°</b>  <b>150°</b>  <b>5:1</b>  <b>Misc</b>	Handrails at NW and S access approx. 300mm adl  HLO refuge 330mm from edge of SLA and 1m adl  Perimeter net at south foam monitor platform Foam monitor platform east and west side various deck structures below helideck west side  NDB Unserviceable No Fuel Available until further notice

#### **Noble Intrepid**

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
	>30kts	Jack Up (MODU) <ul style="list-style-type: none"> <li>• Stable deck conditions to apply whilst on the move:= 1 Deg Pitch &amp; roll 2m heave- (<b>UKCS &amp; GB registered A/C</b>)</li> <li>• Table 1(T) if overflight of 5:1 infringement unavoidable</li> <li>• Marginal obstructions in and close to 150° LOS (<b>marked in obstruction colours</b>)</li> </ul>	<b>150°</b>  <b>5:1</b>	Vent structure aft of helideck - marginal infringement Folding railings on structure aft of helideck - obstruction if raised  Forward foam monitor and access platform

#### **Ensco 120**

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
		Jack up <ul style="list-style-type: none"> <li>• No flights while under tow</li> <li>• Helideck net fitted to achieve required friction standards</li> <li>• Dual Agent not fitted (Norway)</li> </ul>	<b>Misc</b>	Comprehensive electronic pitch, roll and heave measuring equipment. not required when jacked up



# HLL Temporary Limitations Notice

## 4. Additional limitations

### *Judy Platform*

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
		<b>The Judy Helideck will be closed for the duration of this TLN.</b>		

### *EnSCO 120*

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
130°-190°	20-30kts	Exercise Caution due turbulence		
	30+	Table 2		

These restrictions/changes shall remain in force until (unless previously revoked or suspended)	<b>28 February 2025</b>
---	-------------------------

*Aircrew are requested to submit voyage reports advising HCA if the information above is incomplete or incorrect*