


TO:	ALL PILOTS	DATE:	30 September 2024
TLN NUMBER:	008a - 2024		
SUBJECT:	Elgin PUQ with Valaris Stavanger and Shelf Drilling Fortress alongside		

1. Comments

The Elgin PUQ will have the Valaris Stavanger and the Shelf Drilling Fortress alongside for approximately a month.

2. Photo/Dwg

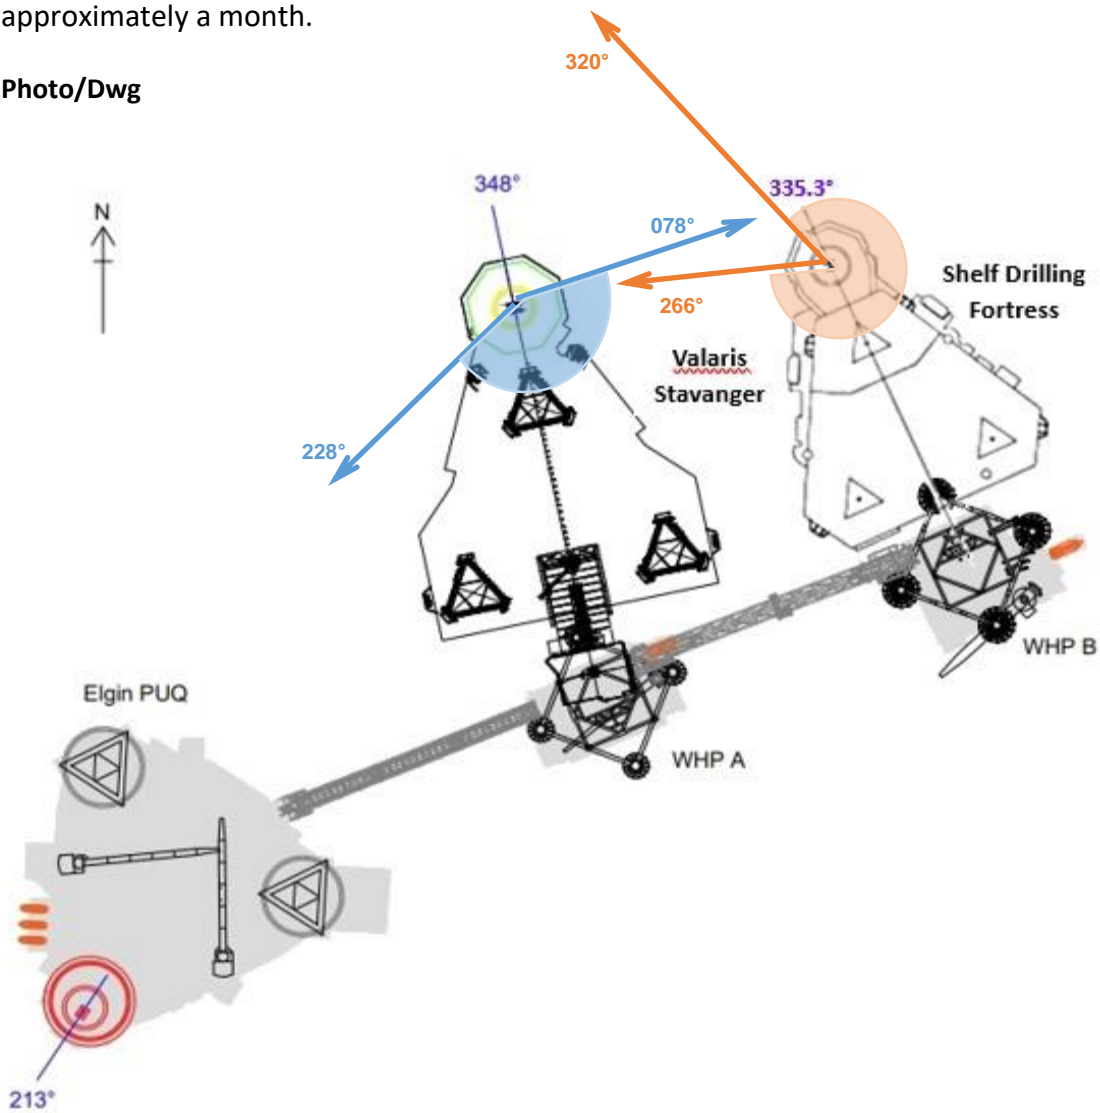

3. Existing HLL limitations

Elgin PUQ

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
015-055	0-15	Please ensure you obtain accurate wind speed & direction early en route to plan your approach • Possible turbulence from Turbine Exhaust and Exhaust Stack	210°	Fixed Handrails and Refuelling Cabinet (south-east) 1.15m, Monitor A (north) 400mm, Monitor B (west) 500mm, Monitor C (south) 450mm, Glass Dome (west) 550mm, Small Dome (west) 300mm
All Winds	0-30 31+	• Table 1 (T) for all operations due to anti turbulence panels. • No restriction	150°	Handrails 1.15m ADL at 1.25m from SLA (run-off north) if not collapsed
			5:1	West Foam Monitor Platform 1.8m from SLA Anti Turbulence Panels 2.8m from SLA

Valaris Stavanger

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
		Jack Up Drilling Rig (MODU) • No flight operations whilst afloat (No P/R/H equipment) • No DG to be uplifted		

Shelf Drilling Fortress

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
		Jack-up • Turbulence Reports to be submitted	Misc	No automated PRH measuring equipment - stable deck conditions - maximum of 1° pitch & roll and 2m heave - will be applied to deck when under tow

4. Additional limitations

Valaris Stavanger

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
078° - 228°	All	Prohibited landing if overflight of adjacent Jack-up or WHP walkways unavoidable	Misc	Adjacent Jack-up & WHP walkways Possible Turbulence Note: Turbulence reports required for all flights

Shelf Drilling Fortress

Wind (T°)	Kts	Limitation /Comment		Non-Compliances
320° - 266°	>20kts	Prohibited landing if overflight of adjacent Jack-up or WHP walkways unavoidable	Misc	Adjacent Jack-up & WHP walkways Possible Turbulence Note: Turbulence reports required for all flights

These restrictions/changes shall remain in force until:- (unless previously revoked or suspended)	7 October 2024
--	-----------------------

Aircrew are requested to submit voyage reports advising HCA if the information above is incomplete or incorrect